Quick Installation Guide

Ver.A (P/N: 60177A0389X00

Accessories

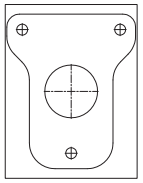
Placement sticker


Quick guide

Dehumidifier packet

Mounting accessory kit


2-axis cable concealed wall mount bracket

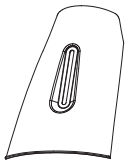
Sunshield

Waterproof connector

Wall mount base

CD (User Manual)

DI/DO & Function Description

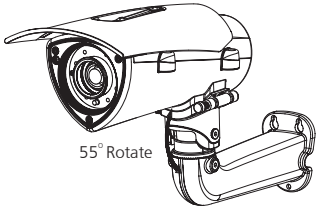

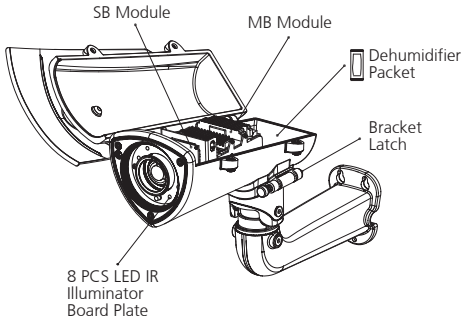

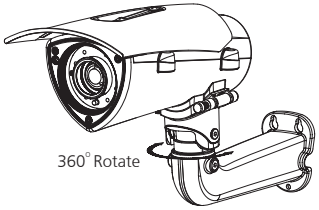

MB Module

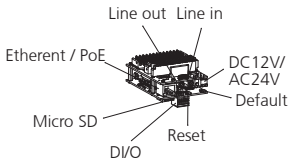

DI/O Pin Definition & Waterproof Connector Description

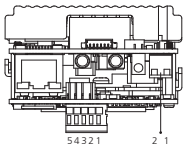

DI/O

1	ALM_IN (+)
2	ALM_IN (-)
3	ALM_out_NC
4	ALM_out_COM
5	ALM_out_NO

POWER

1	AV24V/DC12V (+)
2	AV24V/DC12V (-)

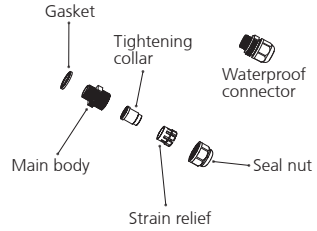

Cable Wiring Description

Cable Installation Steps:

1. Run the cable inside the wall mount bracket and out through the cable opening at the front.
2. Press down the push-lock mechanism and secure the camera onto the push-lock. Wire the network cables to the waterproof connector on the right, and wire the line-in, line-out, DC 12V/AV 24V, DI/O and other cables to the waterproof connector on the left. Tighten the waterproof connector after all the cables are secured in place.
3. Secure the camera onto the wall mount bracket using the two screws provided.
4. Open the camera's top cover to access the wired cables. Install the RJ45 connector to the Ethernet cable and plug it into the corresponding port on the MB module.
5. Close the camera's top cover and secure it with the supplied hardware tool to complete.



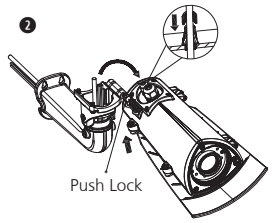

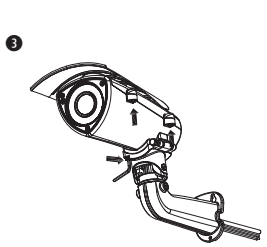

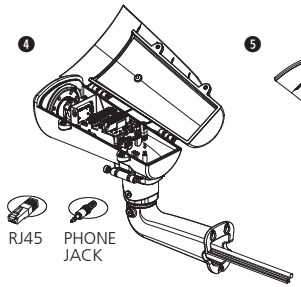

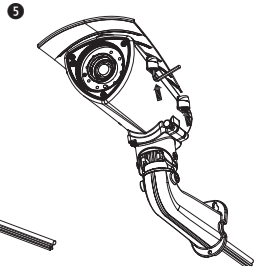

Quick Installation Guide

Ver.A (P/N: 60177A0389X00)

Cable Outlet Description

1. The camera features two waterproof connectors, the right one in the diagram is for PoE connection, while left one is for line in, line out, DC 12V/AC 24V and DI/O connections.
2. The left one features four wire holes. Please cover unused holes with sealing plugs to prevent water from entering.
3. Applicable cable diameter:
   * Ø 2.5~1.8mm (Left)
   * Ø 6.9~4.7mm (Right)

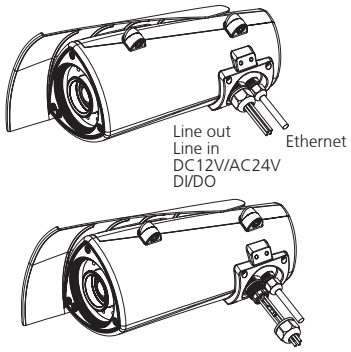

Hardware Installation

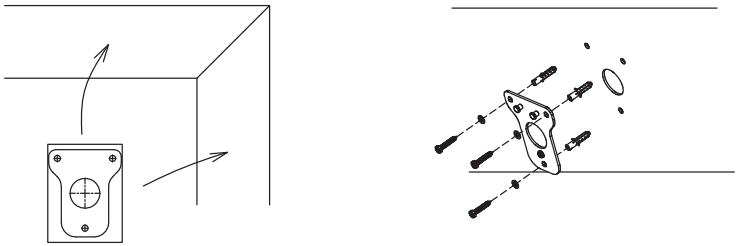

Web Browser (Internet Explorer)

1. Locate and open the Internet Explorer (IE) shortcut on the desktop.
2. In the address bar, type 192.168.1.168 (default IP address of the camera) and then press the Enter button.
3. You will be prompted with a pop-up window asking for logininformation, type in “admin” (default login name) and“9999” (default password)

3. Open the camera’s cover and glue the dehumidifier packet onto the metal bracket using the adhesive sticker on its back, as depicted in the diagram below. Close the camera’s cover and ensure the clip is locked in position. Install the sunshield and tighten a torx screw on the side of cover.

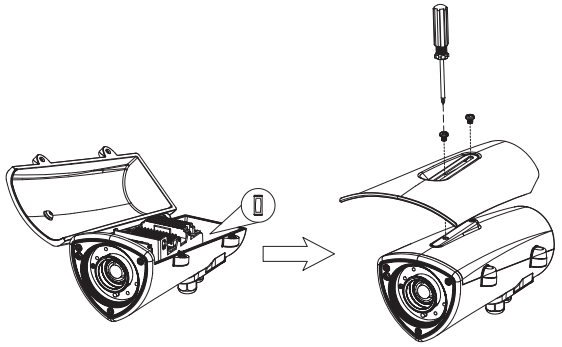

4. Secure the connecting bracket to the camera’s rear.

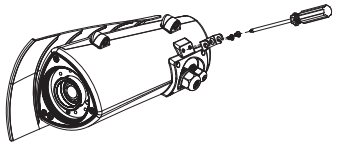

5. Press and hold down the latch on the wall mount bracket and put it into the connecting bracket. Once in place, secure the other side using the supplied hex wrench.

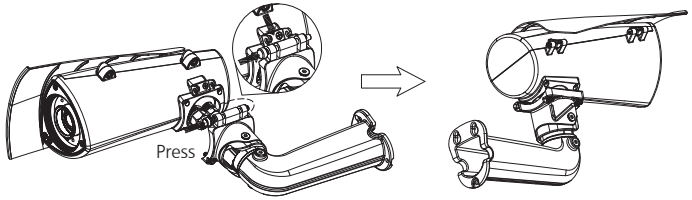
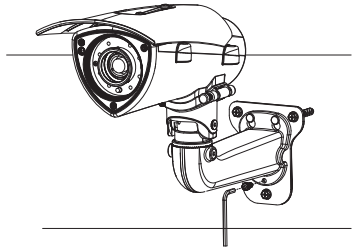
6. Align the mounting holes on the wall mount bracket to the mounting holes on the wall mount plate, then secure it tightly with screws to finish the installation.